



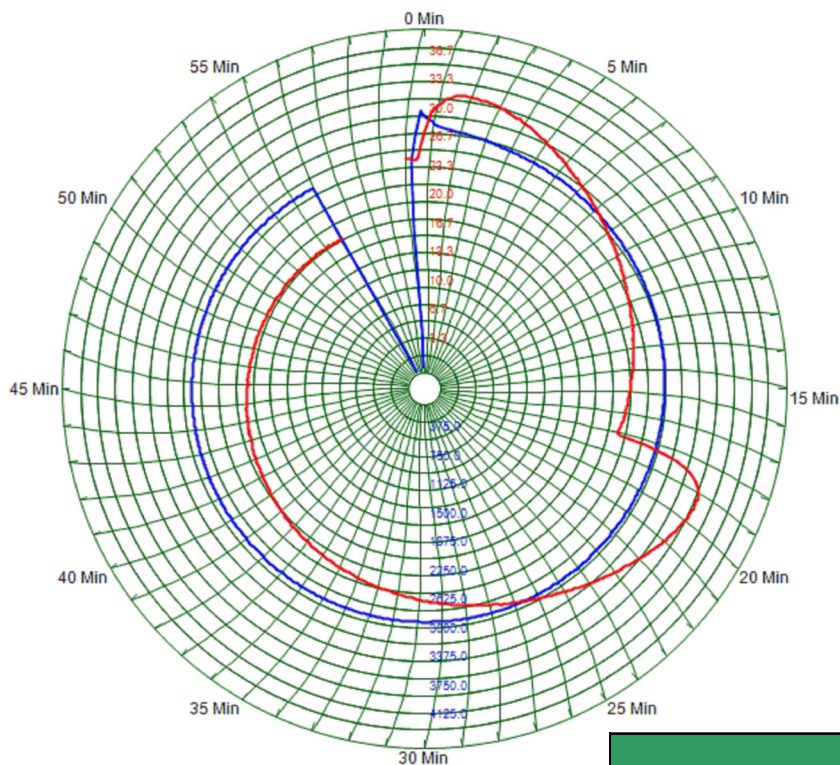


Features

-  Easy to Use Software
-  Digital Chart Records
-  Multiple Sensor
-  Custom Pin or Box Connections Upon Request



| 1.25" OD Pressure Transmitter | | | |
|-------------------------------|-------------|----------------|----------|
| Pressure | Temperature | Connection | Part No. |
| 750 psi | 85 °C | 1/4" NPT | 101631 |
| 1,500 psi | | | 101630 |
| 3,000 psi | | | 101629 |
| 5,000 psi | | | 101628 |
| 10,000 psi | | 1/4" Autoclave | 101627 |
| 15,000 psi | | | 101626 |
| 20,000 psi | | | 101625 |

| 1.25" OD Temperature Transmitter | | | |
|----------------------------------|-------------|------------|----------|
| Assembly Type | Temperature | Connection | Part No. |
| 3" Probe | 200 °C | 1/2" NPT | 101499 |
| 6" Probe | | | 101500 |

| Accessory Type | Part No. |
|------------------------|----------|
| USB Cable 25ft | 100997 |
| USB Cable 50ft | 100998 |
| USB Cable 100ft | 100999 |
| Adapter HM4 SS17-4 | 101636 |
| Adapter 1/2 NPT SS17-4 | 101637 |
| Adapter 3/4 NPT SS17-4 | 101638 |

| Specifications | | |
|----------------------|----------------|---------------|
| | Pressure | Temperature |
| Accuracy Up To | 0.03% F.S. | 0.25 °C |
| Resolution | 0.0003% F.S. | 0.005 °C |
| Drift | < 3 psi / year | < 0.1 °C/year |
| Communication Method | USB | |